
# **Smoke and Dye Testing Summary**

## **High Level Sewershed**

Run Summary —											
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length				
S1028-025	Smoke	8/13/2008	ADS/TM	S11WW_002MH	Dry	Yes	2,709.52				

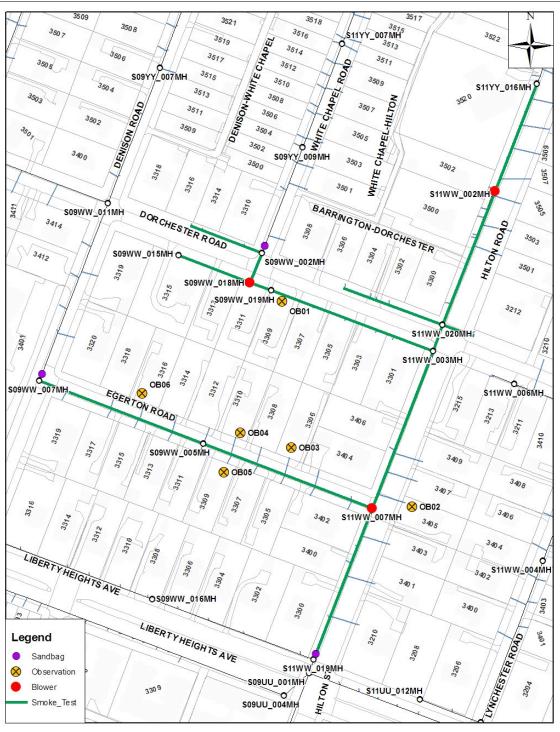

# **Smoke and Dye Testing Summary**

## **High Level Sewershed**

#### Run Summary **Date** Ground **Total** Notification Company / **Test ID Blower MH Test Type** Inspected Condition Length Made? Super. S1028-025 Smoke 8/13/2008 ADS/TM S11WW\_002MH Dry Yes 2,709.52

#### **Isolated Pipes** Length Diameter Pipe ID **Upstream MH** Downstream MH (ft) (In) S11YY\_016G1 S11YY\_016MH S11WW\_002MH 213.5761 8 S09WW\_005G1 S09WW\_005MH S11WW\_007MH 335.2470 8 S09WW\_020G1 S09WW\_020DE S09WW\_002MH 8 143.3126 S09WW\_015G1 S09WW\_015MH S09WW\_018MH 141.9125 8 S11WW\_020MH S11WW\_026G1 S11WW\_026DE 264.4398 8 S11WW\_020G1 S11WW\_020MH S11WW\_003MH 51.65133 8 S11WW\_007G1 8 S11WW\_007MH S11WW\_019MH 301.4089 S09WW\_019G1 S09WW\_019MH S11WW\_003MH 8 320.4048 S09WW\_018G1 S09WW\_018MH S09WW\_019MH 42.04877 8 S09WW\_007G1 S09WW\_007MH S09WW\_005MH 325.9678 8 S11WW\_022G1 S11WW\_022DE S11WW\_020MH 197.4291 8 S09WW\_002G1 S09WW\_002MH S09WW\_018MH 59.10453 8

S11WW\_007MH

### **Observations & Photos**

S11WW\_003G1

**Obs\_ID** S1028-025-OB01 **Address** 3309 Dorchester Rd

Status Private
Source Cleanout

Location Yard - front
Nearest MH S09WW\_019MH

**Comments** Smoke from cleanout, front yard of 3309 Dorchester Rd.

S11WW\_003MH

**Picture** \S1028-025-OB01-P01.jpg

**Comments** Front of house, 3309 Dorchester

**Obs\_ID** S1028-025-OB02 **Address** 3405 Hilton Rd

313.0177

**Status** Private **Source** Cleanout

**Location** Yard - front **Nearest MH** S11WW\_007MH

**Comments** Smoke from cleanout in front yard. 3405

8

Hilton Rd.



**Picture** \S1028-025-OB02-P01.jpg

Comments Front of house, 3405 Hilton Rd.



Tuesday, February 10, 2009

Page 2 of 3

# **Smoke and Dye Testing Summary**

## **High Level Sewershed**

### **Run Summary**

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-025	Smoke	8/13/2008	ADS/TM	S11WW_002MH	Dry	Yes	2,709.52

Obs\_ID S1028-025-OB03
Address 3306 Egerton Rd
Status Private
Source Cleanout
Location Yard - front
Nearest MH S11WW\_007MH

**Comments** Smoke from cleanout in front yard. 3306

Egerton Rd.



**Picture** \S1028-025-OB03-P01.jpg

**Comments** Front of house, 3306 Egerton Rd.

 Obs\_ID
 \$1028-025-0805

 Address
 3309 Egerton Rd

 Status
 Private

 Source
 Cleanout

**Location** Yard - front **Nearest MH** S09WW\_005MH

**Comments** Smoke from cleanout in front yard. 3309

Egerton Rd.



**Picture** \S1028-025-OB05-P01.jpg

**Comments** Front of house, 3309 Egerton Rd.

**Obs\_ID** S1028-025-OB04

Address 3310 Egerton Rd

Status Private
Source Cleanout

**Location** Yard - front **Nearest MH** S09WW\_005MH

Comments Smoke from cleanout in front yard. 3310

Egerton Rd.



**Picture** \S1028-025-OB04-P01.jpg

**Comments** Front of house, 3310 Egerton Rd.

 Obs\_ID
 \$1028-025-0806

 Address
 3316 Egerton Rd

Nearest MH S09WW\_005MH

Status Private
Source Cleanout
Location Yard - front

Comments Smoke from cleanout in front yard. 3316

Egerton Rd.



**Picture** \S1028-025-OB06-P01.jpg

**Comments** Front of house, 3316 Egerton Rd.

